

# CARDONE ProTech

Supporting Today's Professional Technician



## Low Pedal on 1995 F250 and F350 Ford Trucks

### Application:

1995 Ford F250, 350 using 10-4007 or 10-2690.

### Problem:

Low or long pedal action.

### Cause:

According to Ford technical service bulletin TSB 96-25-19, the Master Cylinder should be changed to a unit with a larger bore size.

### Solution:

Before changing the unit, perform the following checks: With the engine off and all vacuum depleted from the booster, check the pedal action. It must be high and hard. If it is not, either the master cylinder is bypassing or something else in the system is causing the low pedal (check ABS valve if so equipped, all flexible brake hoses or for air in system). Note that the booster cannot cause a dropping pedal - it either works or the pedal will be hard.

For 10-4007 (without cruise) changed to 10-2827.

For 10-2690 (with cruise) changed to 10-2828.



10-4007 (1.125" bore)



10-2827 (1.250" bore)

For other ProTech publications, visit [www.cardone.com](http://www.cardone.com)  
CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799