


Application:

Ford & International 6.9 Liter Diesel engines CARDONE Part 59-8304 & 59-8305

Problem:

If the mounting flange on the original pump is 1-1/16" thick at the top two mounting holes and if the replacement unit is 13/16" thick, you must use two 1/8" spacers or 1-1/4" bolts.

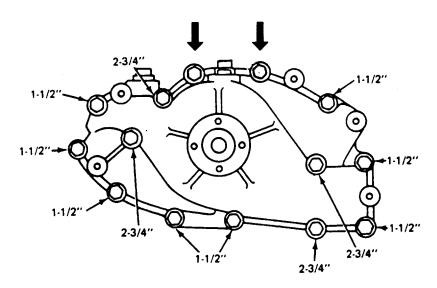

WATER PUMP MOUNTING BOLT LENGTHS & LOCATIONS

Warning:

IF THIS IS NOT DONE, INJECTOR PUMP FAILURE WILL OCCUR AND VOID THE WATER PUMP WARRANTY.

For other ProTech publications, visit www.cardone.com

CARDONE Industries, Inc. • 5501 Whitaker Ave. • Philadelphia, PA 19124-1799

MS 6324 PT 58-0005