

# CARDONE™ ProTech®

Supporting Today's Vehicle Technician



## 81-158PB Replacement Pulse Board Park Problem

### Application

CARDONE™ Wiper Motor Pulse Board part number 81-158PB. See catalog for proper vehicle applications.

### Problem


Wipers will not park after replacing Pulse Board.

### Cause

Contact arms on Pulse Board may not be contacting Wiper Motor. Packing material or movement during shipping may have bent contacts.

### Solution

Check position of contact arms before installation. Contacts should be approximately 1 inch (25 mm) above circuit board (see picture). Correct contact position ensures proper Wiper Motor parking function.

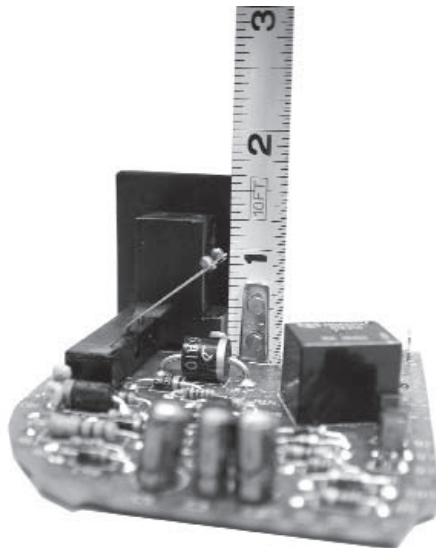

### Note

Refer to ProTech® PT 40-0003 and PT 40-0004 for additional troubleshooting tests for Wiper Motors and Pulse Boards.